

- 1/10/08 - Instrument picked up by 110 Senior Hwy Dist. for CRT repair. 9/26/07 from WSPCT. rem'd keyboard intermittently freezes @ \* Pinkey Inhibited? Co
- 5/12/08 CMP ret'd / pickup from Hope Hwy Dist.
- 5/10/08 1070 EtOH Ref. / 0870 EtOH Lit Cal. dls. performed & removed from 28 pct. due to out of tolerance, replace with Intox. Ser. # 68-013546 (M) \* In Lab \*
- 6/19/08 reported o/l/s due to out of tolerance. performed Dia
- omitted entry 5/27/08 Field inspection - operating properly - ret'd to service. (M)
- 6/18/08 reported o/l/s due to out of tolerance. performed Dia
- omitted entry 6/10/08 Field inspection - operating properly - ret'd to service. (M)
- 6/20/08 Found powered off. Sim. Ser. # DR4153 operating. Powerd Intox. performed field inspection - operating properly. (M)
- 6/20/08 menu left in incorrect mode (.08) - reset to (.100). Target Value.
- 6/27/08 brought to US Pct. to replace Intox. Ser. # 105-010780 @ Cal. dl. performed @ UAB - ECJ (ASU). Sim. Ser. # DR3561 1070 Ref EtOH 23m. changed to new lot # 08070. @
- 5/13/08 Simulator solution changed to same lot # 08010 (exp 7 keyboard from instrument - was working. intermittent keyboard was replaced & the instrument is working properly. Instrument 68-010779 replaced 68-011148. PAA worker notified Hwy District
- 5/27/08 simulator solution in simulator DR3556 changed to lot # 08010. (M)
- Reported o/l/s - out of tolerance - diagnostic & (M) field inspection passed, operating within normal tolerance. Returned to service - Hwy Dist notified.
- 7/29/08 placed out of service due to interferent detected & inoperable fan - internal temp @ 50-8°C Hwy dist. notified. (M) by P2
- 7/30/08 The top of the instrument (including fan) was replaced w/ a new one. The cell temp was observed & monitored. Instrument is in proper working order. Hwy District notified @ Randazzo 1610 hrs. @ by S
- 8/26/08 Simulator solution in Sim DR3561 was changed from lot # 08070 to new lot # 08160 (Exp. ult/08). @ by P2
- 9/9/08 1070 Cal dl performed (M)
- 9/10/08 0870 Cal dl performed / fuses changed for moding jobs could not be downloaded (M)
- 12/1/08 1070 Ref Sel in Sim \* DR3561 changed to lot # 08300

58-010779

141012

1/14/2009: 68-010779 O/P/S at 45 pps - HIV - disinfectant, pages  
and returned to service.

Obtained by Perlmutter & McGuinness, P.C. in Law Offices of Adam D. Perlmutter, P.C. v. NYPD, et al  
Case No. 100-220/2012 (N.Y. Cty. S. Ct.). WWW.NEYORKLEGALDEFENSE.COM - (212) 679-6799

# INTOXILYZER 68-010779

DATE	COMMENTS
2/25/09	.10% Ref solution changed to lot # 09020
3/11/09	Disinfected for HIV at 45 PCT
4/7/09	.10% Ref Sol'n in Sin # DR 3561 changed using same lot # 09020
8/15/09	Placed o/d/s due to diag. failure
8/17/09	Upon inspection instrument found to be in good working order. Replaced sim. solution with new sol. lot # 09150.
	cal check conducted. Hwy Dist notified PO ARAN
8/20/09	Placed o/d/s due to diag. failure replaced by 68-011087.

Obtained by Perlmutter & McGinness, P.C., Law Offices of Aaron D. Perlmutter, P.C. v. NYPD, et al.,  
Case No. 100220/2019 (N.Y. City. Sup. Ct.) WWW.NYPDREGISTRATION.COM - (212) 679-1990